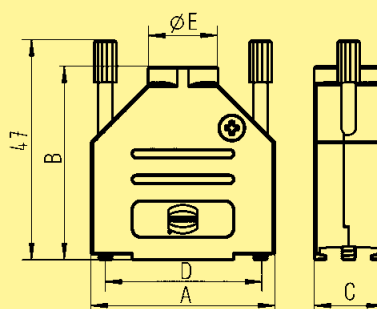



Full metal top and side entry hoods with knurled screws

Identification No. of contacts Part No. Drawing Dimensions in mm

D-Sub

Top entry hood
incl. grommet set
halvesPlease insert digit for
screw optionKnurled screw,
thread
4-40 UNC ▶ 3Knurled screw,
thread M3 ▶ 8Spare knurled screw
thread 4-40 UNC
thread M39
15
25
37
5009 67 009 034 .
09 67 015 034 .
09 67 025 034 .
09 67 037 034 .
09 67 050 034 .

Poles	A	B	C	D	E
9	31.0	39.5	14.8	25.0	11.7
15	39.5	41.5	14.8	33.3	11.7
25	53.5	48.5	14.8	47.0	11.7
37	71.0	53.0	14.8	63.5	11.7
50	67.5	54.0	18.7	61.1	17.0

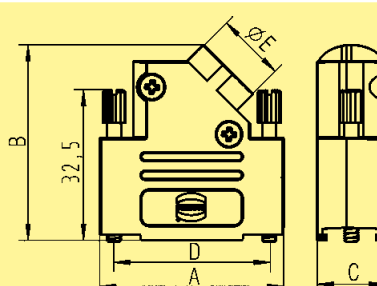Side entry hood
incl. grommet set
halvesPlease insert digit for
screw optionKnurled screw,
thread
4-40 UNC ▶ 3Knurled screw,
thread M3 ▶ 6Spare knurled screw
thread 4-40 UNC
thread M39¹⁾
15
25
37
5009 67 009 033 .
09 67 015 033 .
09 67 025 033 .
09 67 037 033 .
09 67 050 033 .

Poles	A	B	C	D	E
9	31.0	37.7	14.7	—	11.7
15	39.5	42.0	14.7	33.3	11.7
25	53.2	41.3	14.7	47.0	11.7
37	69.7	41.8	14.7	63.7	11.7
50	67.4	44.9	17.4	61.1	17.0


Spare grommet set
halves

9-37 poles

09 67 002 9092

50 poles

09 67 002 9094

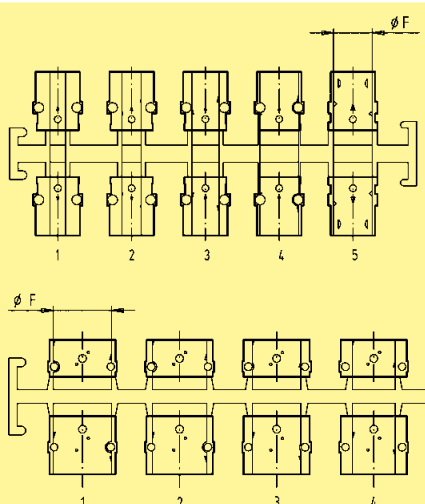

Grommet dimensions		
Number	Diameter F	
	9-37 poles	50 poles
1	4.0	15.0
2	5.0	14.0
3	7.0	12.5
4	9.0	11.0
5	10.2	—

¹⁾ 9-pole hood provided with only one screw on the opposite side of the cable entry.
Operating temperature for all hoods on this page: -40 °C ... +120 °C