

Assembly tools

Crimping tools and inserts for flexible cables	438
Tool sets for semi-rigid cable assembling (solder type)	441
Selection of common and helpful assembly tools	441
Assembly tools for BMA connectors with hermetic seal	446
Assembly tools for SK connectors	446
Torque wrenches	447
Combination tool for MMBX/MMCX/MCX	448
Special tools for QMA connectors	448
Special tools for QN and MMPX connectors	449
Special tools for MBX and MMBX connectors	450

Crimping tools and inserts for flexible cables

Small crimp tool with fixed inserts



HUBER+SUHNER type	Item no.	Size	Colour code	Square section (centre contact)	Hexagonal section (outer contact)
75_Z-0-3-4	22544613	2 B	orange	1.6 mm / .063 in.	5.5 mm / .217 in.
75_Z-0-4-4	22544612	2 C	yellow	1.6 mm / .063 in.	6.5 mm / .256 in.

Small crimp tool with interchangeable inserts 1/2A, 2B, 2C




Fig. 1



Fig. 2

HUBER+SUHNER type	Item no.	Description	Fig.
75_Z-0-0-50	22544754	tool without inserts	1
75_Z-0-0-51	22544755	tool with various inserts in wooden box (1/2A, 2B, 2C)	2

Interchangeable inserts for small crimp tool

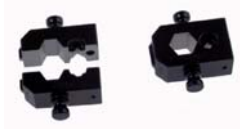

HUBER+SUHNER type	Item no.	Size	Square section (centre contact)	Hexagonal section (outer contact)
76_Z-0-1-1	23000884	0.54/A	0.54 mm / .021 in.	3.3 mm / .130 in.
76_Z-0-2-20	22645153	1/4.95	0.7 mm / .028 in.	4.95 mm / .195 in.
76_Z-0-2-51	22544756	1/2A	0.7/1.6 mm / .028/.063 in.	3.3 mm / .130 in.
76_Z-0-2-53	22645337	1/2.67	0.7 mm / .028 in.	2.7 mm / .106 in.
76_Z-0-3-51	22544757	2B	1.6 mm / .063 in.	5.5 mm / .217 in.
76_Z-0-4-51	22544758	2C	1.6 mm / .063 in.	6.5 mm / .256 in.

Crimping tools and inserts for flexible cables

Large crimp tool with interchangeable inserts 1/2A, 2B, 2C, 3D



Fig. 1



Fig. 2

HUBER+SUHNER type	Item no.	Description	Fig.
75_Z-0-0-1	22543157	tool without inserts	1
76_Z-0-0-15	22543177	tool with various inserts and cutting insert in wooden box (1/2A, 2B, 2C, 3D)	2

Tool boxes



HUBER+SUHNER type	Item no.	Description
76_Z-0-0-9	22644671	large tool box (empty)
76_Z-0-0-11	22543175	large tool box without tooling but including foam insert for tools and allen key

Table press with interchangeable inserts



HUBER+SUHNER type	Item no.	Description
75_Z-0-0-2	22543158	press without inserts (for inserts see page 436)

Crimping tools and inserts for flexible cables

Interchangeable inserts fitting large crimp tool and table press



HUBER+SUHNER type	Item no.	Size	Colour code	Square section (centre contact)	Hexagonal section (outer contact)
76_Z-0-1-2	23000885	0.54/A		0.54 mm / .021 in.	3.30 mm / .130 in.
76_Z-0-2-1	22543181	1/2 A	red	0.7/1.6 mm / .028 / .063 in.	3.30 mm / .130 in.
76_Z-0-2-8	22544191	1/4.95		0.7 mm / .028 in.	4.95 mm / .195 in.
76_Z-0-3-1	22543185	2 B	orange	1.6 mm / .063 in.	5.50 mm / .217 in.
76_Z-0-3-9	22641133	B 1.22/1.22		1.2 mm / .047 in.	5.50 mm / .217 in.
76_Z-0-4-1	22543189	2 C	yellow	1.6 mm / .063 in.	6.50 mm / .256 in.
76_Z-0-4-8	22543190	C 1.22/1.22		1.2 mm / .047 in.	6.50 mm / .256 in.
76_Z-0-5-8	22543192	8/1.22/1.22		1.2 mm / .047 in.	8.00 mm / .315 in.
76_Z-0-5-21	22543193	2/8.0		1.6 mm / .063 in.	8.00 mm / .315 in.
76_Z-0-6-1	22649051	3/8.65		2.4 mm / .094 in.	8.65 mm / .341 in.
76_Z-0-6-21	22543194	2/9.75		1.6 mm / .063 in.	9.80 mm / .386 in.
76_Z-0-7-1	22543195	3 D	violet	2.4 mm / .094 in.	10.70 mm / .421 in.
76_Z-0-7-7	22543196	2 D		1.6 mm / .063 in.	10.70 mm / .421 in.
76_Z-0-7-8	22660322	2.5/D		2.5 mm / .098 in.	10.70 mm / .421 in.
76_Z-0-7-14	22544524	4 D		3.3 mm / .130 in.	10.70 mm / .421 in.
76_Z-0-10-14	23002630	12.4		–	12.40 mm / .488 in.
76_Z-0-0-26	22645880	1/2.67		0.7 mm / .028 in.	2.70 mm / .106 in.
76_Z-0-3-26	84077169	1.22 / B		1.2 mm / .047 in.	5.50 mm / .217 in.
76_Z-0-4-24	84077171	1.22 / C		1.2 mm / .047 in.	6.50 mm / .256 in.
76_Z-0-5-22	84077161	1.22 / 8.0		1.2 mm / .047 in.	8.00 mm / .315 in.

Special insert and tools for large crimp tool and table press



HUBER+SUHNER type	Item no.	Description
76_Z-0-0-1	22543170	cutting insert for cables up to 12 mm/4.72 in. outer diameter
76_Z-0-0-2	22543172	spare blades for cutting insert (10 pieces per package)
76_Z-0-0-3	22543173	support plate for bench mounting of large crimp tool

Tool sets for semi-rigid cable assembling (solder type)

The tool sets include a solid wooden storage case. The composition of these sets is as indicated in the list of tools.



HUBER+SUHNER type	Item no.	Size	Colour code
74_Z-0-0-70	22544725	SMA	includes all tools required for economic and reliable assembling of SMA connectors
74_Z-0-0-71	22641350	N	includes all tools required for assembling of N connectors to semi-rigid cables
74_Z-0-0-72	22544747	SMA	includes only the minimum of tools required for assembling of SMA connectors

Selection of common and helpful assembly tools

HUBER+SUHNER type	Item no.	W-no. *	For series	Description	Tool set 74 Z-0-0-			
					70	71	72	
74_Z-0-0-14	22543124	W14	SMA	locator tools for contact and insulators	•		•	
74_Z-0-0-21	22543130	W21	SMA	torque wrench 1 Nm	•			
74_Z-0-0-24	22543133		SMA	tap drill for SMA (1/4-36 UNS-2B thread)				
74_Z-0-0-29	22543138	W29	N	dielectric insertion tool for insulators series N		•		

* Marking on tool.

Selection of common and helpful assembly tools

HUBER+SUHNER type	Item no.	W-no. *	For series	Description	Tool set 74 Z-0-0-			
					70	71	72	
74_Z-0-0-35	22544282	W35	N	soldering gauge 0.45 mm / .018 in.		•		
74_Z-0-0-52	22544553	W52	SMA	dielectric insertion tool for SMA plugs	•		•	
74_Z-0-0-53	22544554	W53	SMA	dielectric insertion tool for SMA jacks	•		•	
74_Z-0-0-54	22544555	W54	SMA	contact holder for pins and sockets	•		•	
74_Z-0-0-55 74_Z-0-0-56	22544516 22544517	W55 W56	SMA SMA	soldering gauge 0.25 mm / .010 in. soldering gauge 0.4 mm / .016 in.	• •		• •	
74_Z-0-0-58	22544557	W58	BMA, SK, N, SMA	soldering fixture (works with W374)	•	•	•	
74_Z-0-0-59	22544558	W59	BMA, N, SMA	inserts for EZ_141 (works with W58 and W442)	•	•	•	
74_Z-0-0-60	22544559	W60	BMA, N, SMA	inserts for EZ_86 (works with W58 and W442)	•	•	•	
74_Z-0-0-133	22643022	W133	BMA, N, SMA	insert for EZ_47 (works with W58 and W442)				
74_Z-0-0-62	22544561	W62	SMA	locator tool for SMA plugs without pin (works with W58 and W442)				
74_Z-0-0-63	22544562	W63	SMA	trim tool for SMA plugs without pin	•			
74_Z-0-0-66	22544616	W66	N	locator tool (works with W58 and W442)		•		
74_Z-0-0-67	22544640	W67	N	contact holder for pins and sockets series N		•		

* Marking on tool.

Selection of common and helpful assembly tools

HUBER+SUHNER type	Item no.	W-no. *	For series	Description	Tool set 74 Z-0-0-			
					70	71	72	
74_Z-0-0-68	22544715	W68	BMA, SK, N, SMA	1 set of blades with protector	•	•	•	
74_Z-0-0-75	22544807	W75	SK, SMA	assembly tool for hermetic jacks				
74_Z-0-0-81	22641423		SK, SMA	positioner for assembly of coupling nuts	•	•		
74_Z-0-0-142	22643462	W142	SMA	rebore tool	•		•	
74_Z-0-0-157	22643029	W157	BMA, SK, N, SMA	cable stripping tool for EZ_47, EZ_86, EZ_141, SUCO-FORM_86 and 141	•	•	•	
74_Z-0-0-160	22643514			replacement cutting wheels; set for EZ_47, EZ_86, EZ_141 (works with W157)	•	•	•	
74_Z-0-0-164	22643028	W164	BMA, N, SMA	trim tool for centre contacts	•	•		
74_Z-0-0-196 74_Z-0-0-197 74_Z-0-0-198 74_Z-0-0-397	22645359 22645360 22645361 84005300			replacement support cover for EZ_47, EZ_86, EZ_141, EZ_118 (works with W157)				
74_Z-0-0-206 74_Z-0-0-207 74_Z-0-0-208	22645364 22645363 22645362			replacement cutting wheels for EZ_47, EZ_86, EZ_141, (works with W157)				
74_Z-0-0-209	22645585	W209	BMA	locator tool used with W58 and W442 (for BMA plug)				
74_Z-0-0-210	22645586	W210	BMA	locator tool used with W58 and W442 (for BMA jack)				
74_Z-0-0-213	22645593	W213	BMA	removal tool for receptacles with snap-in mechanism				
74_Z-0-0-231	22646131	W231	SK	locator tool for SK plugs (works with W58 and W442)				
74_Z-0-0-232	22646132	W232	SK	locator tool for SK jacks (works with W58 and W442)				

* Marking on tool.

Selection of common and helpful assembly tools

HUBER+SUHNER type	Item no.	W-no. *	For series	Description	Tool set 74 Z-0-0-			
					70	71	72	
74_Z-0-0-233	22646133	W233	SK	inserts for semi-rigid cable EZ_118 (works with W58 and W442)				
74_Z-0-0-234	22646134	W234	SK	replacement cutting wheels for EZ_118 (works with W157)				
74_Z-0-0-246	22646873	W246	SMA	jacket remover for semi-rigid and SUCOFORM cables. After cutting and breaking of jacket with tool W-157, remove separated piece with tool W-246.				
74_Z-0-0-264	22646290	W264	SK	trim tool for centre conductor of semi-rigid cable EZ_118				
74_Z-0-0-265	22646291	W265	SK	spare blade for W264				
74_Z-0-0-270	22648901	W270	1.0/ 2.3	removal tool for 1.0/2.3 inserts				
74_Z-0-0-368	23021264	W368	SMA	locator tool for SMA female (works with W58 and W442)	•		•	
74_Z-0-0-369	23021266	W369	SMA	locator tool for SMA male (works with W58 and W442)	•		•	
74_Z-0-0-374	23022146	W374	BMA, SK, SMA, N	support for soldering fixture (works with W58 and W442)				
74_Z-0-0-375	23022145	W375	BMA, SK, SMA, N	soldering fixture for centre contacts (works with W374)				

* Marking on tool.

Selection of common and helpful assembly tools

HUBER+SUHNER type	Item no.	W-no. *	For series	Description	Tool set 74 Z-0-0-			
					70	71	72	
74_Z-0-0-441	23024586	W441	BMA, SK, SMA, N	collecting tank for coolant or flux (works with W374)				
74_Z-0-0-442	23024588	W442	BMA, SK, SMA, N	soldering fixture (works with W374)				
74_Z-0-0-443	23024584	W443	BMA, SK, SMA, N	for positioning locator tools (works with W442)				
74_Z-0-3-2	22543148	W3-2	SMA, N	stripping gauge for insulation EZ_141	•	•		
74_Z-0-3-4	22543150	W3-4	N	trim tool for EZ_141		•		

* Marking on tool.

Assembly tools for BMA connectors with hermetic seal

HUBER+SUHNER type	Item no.	W-no. *	Description	
74_Z-0-0-211	22645591		soldering fixture for hermetic seal (12_BMA-50-0-3 and 22_BMA-50-0-3)	
74_Z-0-0-214	22645579		torque wrench (box spanner) torque 2.00 Nm, 8 mm hex.	
74_Z-0-0-215	22645580		screwdriver for 12_BMA-50-0-3 to use with 74_Z-0-0-214	

Assembly tools for SK connectors

HUBER+SUHNER type	Item no.	W-no. *	Description	
74_Z-0-0-226	22646136	W226	soldering fixture for glass bead	
74_Z-0-0-227	22646137	W227	soldering fixture for glass bead	
74_Z-0-0-228	22646138	W228	assembling tool for dielectric bead	
74_Z-0-0-230	22646130	W230	step drill (only if sliding contacts are not used)	
74_Z-0-0-235	22646135	W235	step drill (only if sliding contacts are used)	

* Marking on tool.

Torque wrenches



Box-spanner



Torque wrench (standard style)

HUBER+SUHNER type	Item no.	For series	Torque	Opening	Notes
74_Z-0-0-21	22543130	SMA / PC 3.5	1.00 Nm	8.0 mm/.315 in	standard style
74_Z-0-0-45	22544232	SMC	0.30 Nm	6.0 mm/.236 in.	standard style
74_Z-0-0-77	22544820	SMA	1.00 Nm	8.0 mm/.315 in.	box-spanner *
74_Z-0-0-79	22642374	SMA economic	0.45 Nm	8.0 mm/.315 in.	standard style
74_Z-0-0-80	22544821	SMA hermetic	1.95 Nm	7.0 mm/.276 in.	standard style
74_Z-0-0-174	22643898	SK	1.30 Nm	8.0 mm/.315 in.	standard style
74_Z-0-0-189	22644368	SK hermetic	2.00 Nm	8.0 mm/.315 in.	standard style
74_Z-0-0-192	22645084	TNC	1.00 Nm	15.0 mm/.591 in.	standard style
74_Z-0-0-193	22645085	N	1.00 Nm	20.0 mm/.787 in.	standard style
74_Z-0-0-321	22651994	N	1.00 Nm	19.0 mm/.748 in.	standard style
74_Z-0-0-373	23021864	TNC	1.00 Nm	14.0 mm/.551 in.	standard style

* Suitable at high packing density.

Precision torque wrench

- In plastic box
- With calibration certificate



HUBER+SUHNER type	Item no.	For series	Torque	Opening	Notes
74_Z-0-0-492	84104509	SMA, SK, PC3.5, PC2.4 and PC1.85	0.9 Nm	8.0 mm/.315 in	90 ° deflection

Combination tools for MMBX/MMCX/MCX

For protective cap mounting and decoupling



HUBER+SUHNER type	Item no.	Description
74_Z-0-0-30	22543139	assembly tool for 16_MCX and MMBX right angle connectors (decoupling and cap mounting)
74_Z-0-0-225	22645861	16_MMCX-50-1-1, 16_MMCX-50-1-2, 16_MMCX-50-2-1 (decoupling and cap mounting)
74_Z-0-0-272	22648614	all 11_MMCX- and 16_MMCX-connectors (decoupling and cap mounting)
74_Z-0-0-276	22648710	decoupling tool for bulkhead jacks (MCX 75 Ω)
74_Z-0-0-350	23004135	removal tool (16_MMCX)

Special tools for QMA connectors

Decoupling tool for high density applications



HUBER+SUHNER type	Item no.	W-no.*	Description
74_Z-0-0-459	84032400	W459	decoupling tool for high density application (for QMA and QN)

Assembly tool



HUBER+SUHNER type	Item no.	W-no.*	For series	Description
74_Z-0-0-360	23023444	W360	QMA	locator tools for QMA connectors (suitable for semi-rigid cables)

* Marking on tool.

Special tools for QN and MMPX connectors

Decoupling tool



HUBER+SUHNER type	Item no.	W-no.*	For series	Description
74_Z-0-0-459	84032400	W459	QN/QMA	decoupling tool for high density application

Locator tool



HUBER+SUHNER type	Item no.	W-no.*	For series	Description
74_Z-0-0-390	23035218	W390	QN	locator tool for 11 QN and 16 QN connectors (works with W58 and W442)

Locator tool



HUBER+SUHNER type	Item no.	W-no.*	For series	Description
74_Z-0-0-391	23035220	W391	QN	locator tool for 24 QN connectors (works with W58 and W442)

Locator tool for MMPX



HUBER+SUHNER type	Item no.	W-no.*	For series	Description
74_Z-0-0-555_---_E	84020011	W555	MMPX	decoupling tool (distance washers included)
74_Z-0-0-556_---_E	84031617	W556		distance washers (for replacement)

* Marking on tool.

Special tools for MBX and MMBX connectors

Assembly and disassembly tool for MBX



HUBER+SUHNER type	Item no.	Packaging	Operating instruction
74_Z-0-0-488	84101887	single	0000346622

Assembly and disassembly tool for MMBX



Fig. 1



Fig. 2

HUBER+SUHNER type	Item no.	Packaging	Operating instruction	Fig.
74_Z-0-0-437	23023494	single	27378	1 (assembly tool)
74_Z-0-0-557	84032418		0000246815	2 (disassembly tool)

Various tools



HUBER+SUHNER type	Item no.	Description
74_Z-0-0-12	22642718	small saw
74_Z-0-0-13	22644241	replacement saw blade for 74_Z-0-0-12
74_Z-0-0-24	22543133	tap drill (thread 1/4-36 UNS-2B)
74_Z-0-0-89	22644721	screwdriver for female centre contacts (series 7/16)
74_Z-0-0-115	22642492	syringe for casing compound
74_Z-0-0-116	22642493	casting compound (resin 6.75 cm ³ and accelertor 3.0 cm ³) 2 containers
74_Z-0-0-177	22644541	tool for cap mounting (16_SMB/C/S connectors)
74_Z-0-0-229	22646139	tap drill (thread 1/4-36 UNS for blind hole thread)
74_Z-0-0-238	22646071	tap drill (thread 5/8-24 UNEF)